

Reports of No Water, Low Water Level

If the dishwasher will not fill or fills for a short time (example; 30 seconds) and the consumers complaint is poor wash results or detergent not rinse completely from the detergent cup, you should inspect the flood float switch.

Models that may be affected: GDF510, GDF520, ADT521, GDT530, GDF540, and GDT550, GDF570, DDT575, GDT580, GDT680, GDT720, GDT740, PDT750, CDT725, PDT760, CDT765, ZDT800 and ZDT870

Serial Range: May 2012 – July 2014 or HZ - MD

If the switch is separated from the body of the flood float switch assembly as shown below (right), replace the flood float switch assembly, part number **WD21X10519**.

