

# DWTT2512

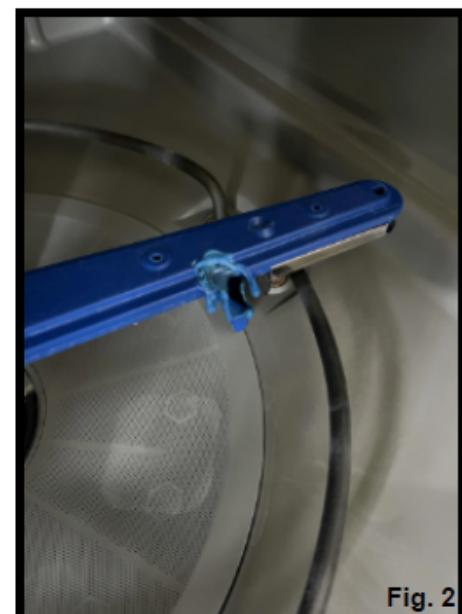
**02.10.25**

## Spray Arm Deformed

**BRAND:**
**Frigidaire**
**MODEL:**
**FDPH4316AS FDPC4314AS GDPH4515AF GDPP4517AD GDPP4517AF FDPC4221AB  
FDPC4221AS FDPC4221AW GDPH4515AF FFCD2418UB FFCD2418US FFCD2418UW  
FFID2426TD FFID2426TS LFID2426TF FGIP2468UF FDPH431LAF FFCD2413UB  
FFCD2413US FFCD2413UW FGID2466QB FGID2466QF FGID2466QW FGID2468UD  
FGID2468UF LFID2422RF FFID2423RS FGBD2434PB FGBD2434PF FGBD2434PW  
FFBD2406NB FFBD2406NS FFBD2406NW FFBD2408NB  
FFBD2408NM FFBD2408NS FFBD2408NW FGBD2438PF  
FGBD2438PW FGBD2438PB LFBD2409LF**
**SERIAL:**
**All**

**CONDITION:**
**Melted spray arm, deformed heater, and/or tub damage.**
**SOLUTION:**
**Please verify the following:**

- 1.) Confirm Round Heater (PN: 154825001) operation.
  - a. Should generate 7A to 9A while energized.
  - b. With the unit unplugged confirm resistance (10 to 20 ohms).
  - c. Check both sides to ground (should be OL).
- 2.) Enter diagnostics test mode. (see Tech Data Sheet)
- 3.) Confirm the unit is filling with water as designed.
  - a. If not filling, confirm water supply is turned on.
  - b. Inspect for debris under the float causing the switch to close contacts. (Fig. 1)
  - c. Remove power from the unit and verify the switch has proper resistance. (Fig. 3)
- 4.) Reference the owners guide for proper loading techniques.
  - a. Utensils are properly positioned.
  - b. Pot & Pan handles are not going through racks to obstruct spray arms.
  - c. Verify plates are not preventing rotation of spray arms.


**Fig. 1**

**Fig. 2**

**Fig. 3**

For Additional Questions Please Contact The Electrolux Technical Support Team: 1-888-842-3660